#### SRB CRITICAL ITEMS LIST

SUBSYSTEM: ELECTRICAL AND INSTRUMENTATION

ITEM NAME: Integrated Electronic Assembly (IEA), Forward (Logic and Networks Distributor and OF Signal

Conditioner)

PART NO.: 10400-0329 FM CODE: A28

ITEM CODE: 50-01-01-02 REVISION: Basic

CRITICALITY CATEGORY: 1R REACTION TIME: Immediate

NO. REQUIRED: 1 DATE: March 1, 2002

CRITICAL PHASES: Separation SUPERCEDES: March 31, 1998

FMEA PAGE NO.: D-25 ANALYST: C. Webster/S. Finnegan

SHEET 1 OF 3 APPROVED: S. Parvathaneni

CN 044

FAILURE MODE AND CAUSES: No output from two of two forward BSM ignition PICs caused by:

o PICs (A and B) fail (open)

o Wiring harnesses (A and B) fail (open or shorted)

FAILURE EFFECT SUMMARY: Loss of forward BSM thrust leads to SRB recontact, damaging ET/Orbiter at separation, resulting in loss of mission, vehicle and crew. One success path remains after the first failure. Operation is not affected until both paths are lost.

## REDUNDANCY SCREENS AND MEASUREMENTS

- 1) Pass Forward BSM PIC A and B Load Test B55X1834X, B55X1835X. Forward BSM PIC A and B Resistance Test B55X1816X, B55X1817X.
- 2) Fail Not verifiable; no measurements available.
- 3) Pass No credible causes.

## RATIONALE FOR RETENTION:

## A. DESIGN:

1. System Description

See Appendix A, Section 1, Paragraph (s)  $E(1) & \underline{I}$ 

2. Component Description

See Appendix A, Section 2, Paragraph (s) A,F(1)(4),I

FM Code: 50-01-01-02-A28 Date:March 1, 2002

#### B. TESTING

## 1) VENDOR RELATED:

See Appendix A, Section 3, Paragraph(s) A(3)(5), B

#### 2) KSC RELATED:

See Appendix A, Section 3, Paragraph B

### 3) SYSTEM FUNCTIONAL/FAILURE MODE UNIQUE:

SRB Forward Skirt Assembly Checkout (ACO): SRB Forward Skirt Stand Alone Test - The SRB BSM Ignition A and B PIC functions are verified per 10REQ-0021, paras. 1.2.2.7.3.1, 1.2.2.7.3.5, 1.2.2.7.2.1, and 1.2.2.7.2.5. (All Failure Causes)

#### Prelaunch Tests -

Shuttle Interface Test (SIT) - The BSM ignition A and B PIC to NSI wiring resistance circuits, including the wiring internal to the Forward IEA, are verified per OMRSD File V, Vol. 1, Requirement Number B75PI0.011. (Wiring Harness)

Ordnance Installation - The BSM ignition A and B PIC Arm and Fire circuits are verified per OMRSD File II, Vol. 1, Requirement Number S00000.525. (All Failure Causes)

Terminal Countdown Demonstration Test - The BSM ignition A and B PIC to NSI interface wiring resistance, including that wiring internal to the Forward IEA, is verified per OMRSD File II, Vol. 1, Requirement Number S00FA0.015. (Wiring Harness)

Launch Countdown - The SRB BSM Ignition A and B PIC resistance test verifies the proper PIC to NSI connections per OMRSD File II, Vol. 1, requirement number S00FA0.015. (Wiring Harnesses)

Last Test of Failure Mode Prior to Launch - Ordnance Installation test is final verification of proper operation of the BSM Ignition A and B PIC Arm and Fire circuits per OMRSD File II, Vol. 1, Requirement Number S00000.525. (All Failure Causes)

CN 044

#### C. INSPECTION

#### 1) VENDOR RELATED:

See Appendix A, Section 4, Paragraph(s) A,F,I

## 2) KSC RELATED:

See Appendix A, Section 5, Paragraph(s) A.(1),A.(2)(e),B.(1)(e)

#### D. FAILURE HISTORY

Failure Histories may be obtained from the PRACA database.

Supercedes: March 31, 1998 DRD 1.4.2.1-b

FM Code: 50-01-01-02-A28 Date:March 1, 2002

# E. OPERATIONAL USE

Not applicable to this failure mode.

## F. WAIVERS/DARS

See Appendix E, Paragraphs 2, 5-15.